

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011188	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 03/13/2018
--	--	---	---

NAME OF PROVIDER OR SUPPLIER RICHMOND HILL REST HOME # 5	STREET ADDRESS, CITY, STATE, ZIP CODE 95 RICHMOND HILL ROAD ASHEVILLE, NC 28806
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of Construction Section Biennial Survey by Dennis Harrell on 3-13-2018. Records indicate this 12 bed facility was first licensed on 12-21-1989. Based on this information, the facility was surveyed using the 1978 NC State Building Code for Institutional Unrestrained Occupancies, the 1987 Minimum Standards and Regulations for Homes for the Aged and Disabled and the applicable portions of the current Rules for Adult Care Homes of Seven or More Beds.	C 000	<i>Please see attached.</i>	
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: a. Hole in the wall behind the door in the SIC quarters, b. Hole in the wall behind the door in the mop	C 189		

Division of Health Service Regulation
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Stacie W. [Signature]
STATE FORM

Administrator

3-29-18

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL011188	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 03/13/2018
NAME OF PROVIDER OR SUPPLIER RICHMOND HILL REST HOME # 5		STREET ADDRESS, CITY, STATE, ZIP CODE 95 RICHMOND HILL ROAD ASHEVILLE, NC 28806		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 1 room, c. Unsealed wire penetration in the ceiling above the nurse's desk. 2. Based on observation, corridor doors do not fit or close properly to resist the passage of fire and smoke. Corridor doors that do not properly fit present the possibility that a fire that begins in one space can quickly spread to the corridor and the remainder of the facility. Findings include; a. There is a hole at the lock through the door to the living room. b. There is a hole at the lock through the door to bedroom 7. c. The door to the dining room does not fit the opening properly at the top to be resistant to the passage of smoke. d. The door to bedroom 1 drags the frame and is difficult to close and latch. 3. Based on observation, an electrical outlet was not maintained in an operating condition. Finding includes: There was no power at the GFCI receptacle in the Men's bathroom #1	C 189		

Check at 12 and 3

3-15-18 E.F.

Weekly Water Temperatures

RH # 5

Week 1

Bath room #1 _____

Bath room #2 111

Shower 113

Date 3-15-18

Bath room #3 110

Shower 113.4

Time 8:30 AM

Bath room #4 _____

Int. S.F.

Bath room #5 _____

Bath Tub _____

Week 2

Bath room #1 108.1

Bath room #2 112.9

Shower 108.3

Date 3-15-18

Bath room #3 109.1

Shower 108.1

Time 1:12 pm

Bath room #4 _____

Int. DO

Bath room #5 111.6

Bath Tub 103.2

Week 3

Bath room #1 109.5

Bath room #2 110.7

Shower 111.2

Date 3-15-18

Bath room #3 105.8

Shower 109.9

Time 9:30 pm

Bath room #4 _____

Int. (LR)

Bath room #5 107.7

Bath Tub 104.8

Week 4

Bath room #1 _____

Bath room #2 _____

Shower _____

Date _____

Bath room #3 _____

Shower _____

Time _____

Bath room #4 _____

Int. _____

Bath room #5 _____

Bath Tub _____

Biennial Construction Survey
Date – March 13, 2018

SOD and POC
Richmond Hill Rest Homes #5

10 A NCAC 13F.0311

Meeting with all staff members to go over what they need to observe during their day-to-day activities in each home. Maintenance request forms will be faxed to the office and completed with in five (5) business days. Administrator and/or designee will monitor the maintenance request and their completion.

Completion Date: March 22, 2018 and Ongoing

Weekly hot water temperatures will be completed weekly and monitored by the administrator or designee.

Completion Date: March 22, 2018 and Ongoing

All GFCI receptacles will be monitored monthly by maintenance staff and reviewed by administrator or designee.

Completion Date: March 22, 2018 and Ongoing

The holes located in the fire rated walls in the SIC quarters and mope room were repaired on March 21, 2018.

Please see the attached worksheet for repairing the issues found at each home and along with the completion date. As of March 22, 2018 all repairs were completed.

House # 1

Shower head replaced on March 22,2018.

Corridor door – door to dining room will not latch when closed. Completed March 22, 2018 with new doorknob.

Ceiling compromised in nurse's station. Completed repair March 22, 2018 with fire rated caulking.

Hot water temperature registering 90 degrees – temperature increased March 22, 2018. Please see log attached.

House #2

Ceiling compromised in nurse's station. Completed repair March 22, 2018 with fire rated caulking.

Hot water temperature registering 90 degrees – temperature increased March 22, 2018. Please see log attached.

House #3

Ceiling compromised in nurse's station. Completed repair March 22, 2018 with fire rated caulking.

GFCI in Men's bathroom #1 replaced March 20, 2018.

House #4

Ceiling compromised in nurse's station. Completed repair March 22, 2018 with fire rated caulking.

Hot water temperature registering 90 degrees – temperature increased March 22, 2018. Please see log attached.

House #5

Ceiling compromised in nurse's station. Completed repair March 21, 2018 with fire rated caulking.

Hot water temperature registering 90 degrees – temperature increased March 21, 2018. Please see log attached.

Hole in the SIC quarter wall and mop closet wall repaired March 21, 2018

The Doorknob to the living room replaced March 21, 2018

Doorknob replaced on #7 door march 21, 2018

Door to the dining room adjusted to fit opening repaired on March 21, 2018

Door #1 adjusted to repair drag at top March 21, 2018

GFCI replaced in the men's bathroom #1 March 21, 2018

All Staff Members of Richmond Hill Rest Homes

Please be aware that whenever you notice something requires maintenance you must complete the Maintenance Request Form and fax to the office as soon as it is noticed. This includes but is not limited to the surrounds of each home, example: doors that do not latch, door handles that do not latch, holes in any sheet rock or doors, fixtures that are broken, all doors must close without rubbing frame, water temperatures that are over or under the state regulation (see specific rule below). Maintenance Request form attached.

10A NCAC 13F .0311 OTHER REQUIREMENTS

- (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition.
- (b) There shall be a heating system sufficient to maintain 75 degrees F (24 degrees C) under winter design conditions. In addition, the following shall apply to heaters and cooking appliances.
- (1) Built-in electric heaters, if used, shall be installed or protected so as to avoid burn hazards to residents and room furnishings.
 - (2) Unvented fuel burning room heaters and portable electric heaters are prohibited.
 - (3) Fireplaces, fireplace inserts and wood stoves shall be designed or installed so as to avoid a burn hazard to residents. Fireplace inserts and wood stoves shall be U.L. listed.
 - (4) Ovens, ranges and cook tops located in resident activity or recreational areas shall not be used except under facility staff supervision. The degree of staff supervision shall be based on the facility's assessment of the capabilities of each resident. The operation of the equipment shall have a locking feature provided, that shall be controlled by staff.
 - (5) Ovens, ranges and cook tops located in resident rooms shall have a locking feature provided, controlled by staff, to limit the use of the equipment by residents who have been assessed by the facility to be incapable of operating the equipment in a safe manner.
- (c) Air conditioning or at least one fan per resident bedroom and living and dining areas shall be provided when the temperature in the main center corridor exceeds 80 degrees F (26.7 degrees C).
- (d) The hot water system shall be of such size to provide an adequate supply of hot water to the kitchen, bathrooms, laundry, housekeeping closets and soil utility room. The hot water temperature at all fixtures used by residents shall be maintained at a minimum of 100 degrees F (38 degrees C) and shall not exceed 116 degrees F (46.7 degrees C).**
- (e) All multi-story facilities shall be equipped with elevators.
- (f) In addition to the required emergency lighting, minimum lighting shall be as follows:
- (1) 30 foot-candle power for reading;
 - (2) 10 foot-candle power for general lighting; and
 - (3) 1 foot-candle power at the floor for corridors at night.
- (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces:
- (1) soiled linen storage;
 - (2) soil utility room;
 - (3) bathrooms and toilet rooms;
 - (4) housekeeping closets; and
 - (5) laundry area.
- (h) In facilities licensed for 7-12 residents, an electrically operated call system shall be provided connecting each resident bedroom to the live-in staff bedroom. The resident call system activator shall be such that they can be activated with a single action and remain on until deactivated by staff at the point of origin. The call system activator shall be within reach of the resident lying on the bed.

- (i) In newly licensed facilities without live-in staff, an electrically operated call system shall be provided connecting each resident bedroom and bathroom to a staff station. The resident call system activator shall be such that they can be activated with a single action and remain on until deactivated by staff at the point of origin. The call system activator shall be within reach of the resident lying on the bed.
- (j) Except where otherwise specified, existing facilities housing persons unable to evacuate without staff assistance shall provide those residents with hand bells or other signaling devices.
- (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.

*History Note: Authority G.S. 131D-2.16; 143B-165;
Eff. January 1, 1977;
Readopted Eff. October 31, 1977;
Amended Eff. July 1, 1990; April 1, 1987; April 1, 1984;
Temporary Amendment Eff. December 1, 1999;
Amended Eff. July 1, 2000;
Recodified from Rule .0309 Eff. July 1, 2004;
Temporary Amendment Eff. July 1, 2004;
Amended Eff. July 1, 2005.*

RHRH MAINTENANCE REQUEST FORM

UNIT # _____

REQUEST

REQUESTED BY _____

DATE REQUESTED _____

DATE COMPLETED AND INITIALS _____

WATER TEMPERATURE LOG

Richmond Hills Unit					
DATE	LOCATION	TIME	TEMPERATURE	ACTION IF NECESSARY	STAFF

WATER TEMPERATURES ARE TO BE CHECKED WEEKLY AND RECORDED. VARIANCES ABOVE OR BELOW STATE REGULATIONS ARE TO REPORTED TO THE ADMINISTRATOR TEMPERATURES ABOVE 116 ARE TO NECESSITATE IMMEDIATE ACTION