Division of Health Service Regulation

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 R B. WING HAL049004 12/07/2023 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 3134 HARMONY HIGHWAY **ROSEWOOD ASSISTED LIVING** HARMONY, NC 28634 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X5) COMPLETE DATE (X4) ID (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** CROSS-REFERENCED TO THE APPROPRIATE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) TAG DEFICIENCY) {C 000} Initial Comments {C 000} Report of a Biennial Follow Up Construction Survey by Ed Miller, conducted on December 7, 2023. There were deficiencies from the Biennial Survey that have not been completed or corrected that requires a new Plan of Correction. {C 175} Bedroom Furnishings-Clean Towel, Towel Bar {C 175} SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND **FURNISHINGS** (b) Each bedroom shall have the following furnishings in good repair and clean for each resident: (7) individual clean towel, wash cloth and towel bar in the bedroom or an adjoining bathroom; and (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the facility failed to provide residents areas with the required number of individual towel bars. Findings on December 7, 2023: a. Entire Building - a few Bedrooms and their shared Restrooms did not have the correct quantity of functioning individual towel bars. {C 189} Building Equipment Maintained Safe, Operating {C 189} SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical. mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE (X6) DATE

Division of Health Service Regulation						
STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED	
HAL049004		B. WING		R 12/07/2023		
NAME OF F	PROVIDER OR SUPPLIER	STREET AD	DRESS, CITY, S	STATE, ZIP CODE		
3134 HARMONY HIGHWAY						
ROSEWOOD ASSISTED LIVING HARMONY, NC 28634						
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPRO DEFICIENCY)	JLD BE COMPLÉTE	
{C 189}	Continued From page 1		{C 189}			
	operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.		, ,			
	This Rule is not met as evidenced by: 5. Based on observation, the smoke-tight corridor doors are not maintained in a safe and operating condition. Findings on December 7, 2023: a. Front Hall, Bedroom 1 - when the corridor door is closed, there is a 5/8-inch gap between the face of the door leaf and the doorframe stops. This exceeds the allowable gap of 1/4 inch for a non-sprinklered building. b. Back Hall, Bedroom 16 - the corridor door will not close and latch without lifting the door.					
	maintained in a saft that clothes dryer dopen free area. This staff and visitors by (fuel for a fire) Findings on Decemb. Exterior near Lacap/backdraft damp& vermin from ented detached and laying interview with Direct contents.	aundry - the dryer's wall per, used to keep the elements ring the duct/building was g on the sidewalk. Per an etor the cap/backdraft damper as not observed while				

6899

Division of Health Service Regulation STATE FORM

If continuation sheet 2 of 2 KSV422